




T.			U_f		Cl.	U_a	U_g	I_a	I_g	S	μ	$U_{g\approx}$	$R_{a/a}$	P_o	P_a
			V	A											
DA 60	MOG	1	6	4	stat	500	-130	120		3	2,5				60
ESW 501	Maz	3	6	4	stat	1000 1500		50		1,3	8				60
MZ 05-60	Mul	1	6	1,7	A	500	-120	120				85	2	11	60
					AB 1	650	-195	$(82,5 \div 115) \times 2$			138 \times 2	7,5	40	55 \times 2	
					AB 2	600	-180	$(65 \div 112) \times 2$	16 \times 2			8	66	39 \times 2	
					stat	500		120		3,2	3				
				stat	650		maximum								60
P 60/500	Tu	2	6	4	stat	1000		maximum		3,5	4				75


T.	C_g	C_a	$C_{g/a}$
	pF	pF	pF
ESW 501	1,63	1,26	4
MZ 05-60	5,5	3,5	9,5
P 60/500	8	7	9

Equivalents DA 60


DO 60	Mul
ES 60	Maz
660 T	Cos

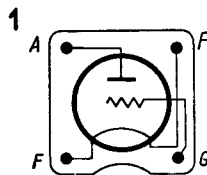

DA60

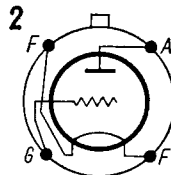

P60/500

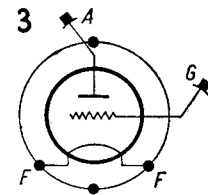

ESW501

